TS-MPPT-150V

ω	2 1	0	Bit	15	14	13	12			10			9	00		7	6				G		4		ω	2		ь		о <u>В</u>	
4	ωN	ь		16	15	14	13			11			10	9		00	7				σ		ы		4	ω		2		ь	
Heatsink temp sensor open	RTS shorted RTS disconnected	RTS open	Alarm	unused	Battery HVD Max	Current Offset	RS-232 Serial to Meter Bridge			Reset			EEPROM retry limit	RTS disconnected		RTS shorted	Custom settings edit				DIP switch changed		array HVD		battery HVD	software bug		FETs shorted		Fault overcurrent	l
	R/Y - G/Y R/Y - G/Y				R - G	R - Y - G	R-Y-G			R-Y-G			R - Y - G	R/Y - G/Y		R/Y - G/Y	R-Y-G				R - Y - G		R-Y-G		R I G	R – Y – G		R - Y - G		R/Y – G	
Heatsink temp. sensor open circuit	Short circuit detected in Remote Temp Sensor See Fault: RTS shorted above. Remote Temp Sensor has been disconnected (was properly connected) See Fault: RTS disconnected above.	Remote Temp Sensor Disconnected (always set if no RTS connected)			Battery voltage exceeds high voltage disconnect threshold - halt in charging	Erroneous current reading when there should be zero current, could lead to inaccurate load and/or array current measurements	TS Meter reprogramming bridge mode failure			A power down reset has occurred Slave mode charging control has timed-out			EEPROM Communications Problem	Remote Temp Sensor has been disconnected (was properly connected)		Short circuit detected in Remote Temp Sensor	EEPROM Settings edited while running				DIP switch changed while running		PV input voltage above safe operating limit		Battery voltage exceeds high voltage disconnect threshold - halt in charging	A software error has occurred in the processor		MOSFETs shorted		The charge or load current exceeds the controllers rating	
Damage to heatsink temperature sensor	See Fault: RTS shorted above. d) See Fault: RTS disconnected above.	RTS not connected			See Fault: battery HVD above.	Failed current offset routine Damage to current measurement circuit	TS Meter not accepting firmware update Hardware failure	Controller has not received a slave command in over 60 seconds		Controller has lost power Loss of communications with controller	Hardware failure	EEPROM (long term memory)	Environmental noise causing on-board communications problems with		causing an erroneous reading	The RTS cable has been pinched or otherwise shorted The RTS terminal connections have collected dust/moisture and are		A set noint was changed via custom programing	Dirt/Debris/Condensation	DIP switch(s) not fully in on/off position	User changed a DIP switch during operation		Array input voltage exceeds operational ratings	Power MOSEET's may be shorted	Another charging source in the system is over-charging the battery	This is an internal software problem	Solar input voltage too low	A power MOSFET is damaged An external short has occurred	The current sense circuitry is malfunctioning	PV Array is too large	Causes
Without accurate temperature sensor, controller cannot prevent the heatsink temperature from exceeding safe	See Fault: RTS shorted above. See Fault: RTS disconnected above.	RTS not required for operation, RTS can be connected if desired for more accurate temperature compensated charging			See Fault: battery HVD above.	Report controller and allow sweeth of all by lither. Cleans it Alarm returns Contact distributor for service	Retry, try different RJ-11 cable, try different TS Meter Contact distributor for service	Check to make sure master device is configured to send slave commands at least once every 60 seconds	check master device is still powered and sending communities	Check physical communications connection to controller,	Contact distributor for service	Fault returns.		cable for breaks.	alcohol if necessary	Inspect RTS cable and connection Inspect RTS terminals for dust/dirt/moisture and clean with	may also be used.	corrosion, debris Restart/power cycle to reset. MSView Coil Reset command	Inspect the PCB around the DIP switches for moisture,	Check all DIP switches to ensure they are in full 'on' or 'off position	Return the DIP switches to original position or reset the PSMPPT so that the new changes take effect.	array voltage below maximum annig, be sure to take into	Consult documentation for maximum array voltage. Keep	SSMPP I charging voilage: Contact distributor for service	Remove the other charging source, check its operation and charging voltage. Keep the charging voltage at or below the	Opdate to latest lillimate iron the worlingson woode	Ensure PV Voc is greater than battery voltage	Refer to the Instar MUSFEI Replacement insuluctions Be sure the positive input/output power terminals are not	TriStar Requires Service or replacement	Consult the TriStar documentation for maximum current rations	Solutions

21-23			20	19	18			17		16	15		14	12-13	11		10			9			œ			7		თ					رب ر			4	Bit	
22-24			21	20	19			18		17	16		15	13-14	12		11			10			9			œ		7					σ			S		
unused			Alarm 21	Controller was reset	ADC input max			High input voltage current limit		P12	MOSFET open		Miswire	unused	RIS miswire		Uncalibrated			Battery sense disconnected			Battery sense out of range			Current offset		Current limit					High temperature current limit			Heatsink temp sensor shorted	Fault	
															R/Y-G/Y					R/Y - G/Y			R/Y - G/Y														LED Indication	
			EEPROM Communications Problem	A power down reset has occurred	ADC input max			PV input voltage too high, current limiting to protect hardware	correctly, but this is an indication of a potential hardware failure.	P12 Internal power supply out-of-range. Unit should still operate	MOSFET(s) damaged - open circuit		External system wiring error		Remote Temp Sensor Wirea Incorrectly	voltage readings may result	Factory calibration was not performed, inaccurate current and/or			Battery sense was working, now out of range			Battery sense voltage out of acceptable range		lead to inaccurate load and/or array current measurements	Erroneous current reading when there should be zero current, could		Active limiting of charging current					Heatsink High Temperature Warning, reduction of charging current			Heatsink temp. sensor short circuit	Description	
			Comm EEprom lockup (Control & Ethernet processors stop talking)	See Fault: Reset above.	Internal hardware problem			Array input voltage too high for safe operation		Internal hardware problem	Hardware failure		Wiring installation error		battery sense and/or KIS Wired incorrectly		Calibration of measurement circuits not performed at factory		Greater than 5V difference between Sense and Battery Voltage	Disconnected wire on the Battery Sense		Greater than 5V difference between Sense and Battery Voltage	Disconnected wire on the Battery Sense	Damage to current measurement circuit		Failed current offset routine		Input power exceeds controller rating			Excessive ambient temperature		Poor airflow around controller			Damage to heatsink temperature sensor	Causes	
	problem with old firmware.	error may be related to the I2C communications lockup	make sure that the unit has the latest A and B firmware - this	See Fault: Reset above.	Contact distributor for service	account temperature effects on the array Voc.	array voltage below maximum rating. Be sure to take into	Consult documentation for maximum array voltage. Keep		Contact distributor for service	Contact distributor for service	circuits and unconnected wires.	Check all wiring for correct connections, check for short	With correct polarity	custing patrery sense and NTS when to confect reliminars	1	Contact distributor for service.	power cables and connection.	Inspect Battery sense wires and connection. Inspect Battery	Inspect Battery Sense connection	power cables and connection.	Inspect Battery sense wires and connection. Inspect Battery	Inspect Battery Sense connection	Contact distributor for service	Alarm returns	Reboot controller and allow sweep of array input. Check if	output.	No action required, controller will operate at full rated	SSMPPT. See manual for more information.	Ensure temperature is below maximum temp rating of	Check ambient temperature at the controller location.	clearance on all sides. See manual for more information.	Ensure controller is mounted in a position with enough	levels. Contact distributor for service.	prevent the heatsink temperature from exceeding safe	Without accurate temperature sensor, controller cannot	Solutions	